

Product
Serial number
Date of calibration


XR20 Rotary Calibrator
4PJL43
19 October 2022

RENISHAW 
apply innovation™

Calibration certificate

Specification **Positional error** ± 1.0 arcsec


Measured values and uncertainties of calibration

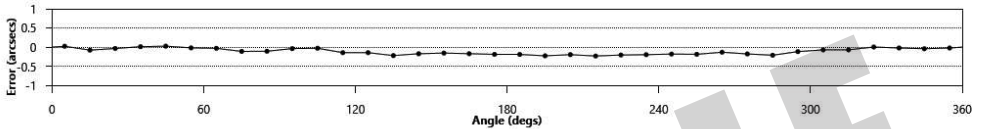

Results	Value
Maximum error:	± 0.23 arcsec
Uncertainty of measurement (95% confidence level, $k=2$):	± 0.46 arcsec

Environmental conditions (nominal)	Value
Air temperature:	19.7 °C
Pressure:	1012 mbar
Relative humidity:	48.5 %RH

Reference standards	Ref. no.	Certificate no.	Calibration date
Renishaw XL-80	10R898	10R898-220131-00	31 January 2022
Renishaw XC-80	8P1708	8P1708-220228-00	28 February 2022
Renishaw XC Air Temperature Sensor	22Y320	22Y320-220420-00	20 April 2022
Test procedure	WI-10814/RD-0136		

Authorised signature	Signatory	Position	Issue date
	Chris Hunt	General Manager	20 October 2022

This certificate may not be reproduced other than in full, except with the prior written approval of:

Renishaw plc
Laser & Calibration Products Division
Bath Road, Woodchester
Stroud
Gloucestershire
GL5 5EY
United Kingdom
Tel. +44 (0) 1453 524524

Certificate number
4PJL43-221019-01

L-9920-0131-01

www.renishaw.com

Page 1 of 2

Calibration notes

1. **Lasers (XM, XL, ML, HS and RLU)** are calibrated by comparison to a reference HeNe laser using an optical beat frequency technique. Reference lasers are routinely calibrated against an iodine-stabilised HeNe laser supplied by the National Physical Laboratory (NPL), or by a national standards laboratory. All frequency measurements are taken over a 1 hour period.
2. **Air pressure and relative humidity (RH) sensors are installed in a compensator (XC and RCU).**
The air pressure sensors are calibrated over 650 mbar to 1150 mbar range in a temperature controlled oven by direct comparison with a reference pressure meter. The RH sensors (where fitted) are certified by the manufacturer to be within specification. They are calibrated by comparison of the readings with those from a reference RH meter at a single applied humidity.
3. **Air and material temperature sensors (XC and RCU)** are calibrated by direct comparison with transfer platinum resistance thermometers (PRTs) in a temperature controlled water bath over 0 °C to 40 °C (50 °C for material sensor). The transfer PRTs are routinely calibrated against reference PRTs.
4. **Rotary axis calibrators (XR20)** are calibrated using a HeNe laser angular interferometer.
5. **Ballbar transducers (QC20 and QC10)** are calibrated using a HeNe laser interferometer. The scale factor (QC10 only) is calculated and must be entered into the Renishaw application software prior to use.
6. **Ballbar calibrators** are calibrated by direct comparison with a reference ballbar calibrator (calibrated by a national standards laboratory) using a reference ballbar as a transfer standard. The measured values for the ballbar calibrator must be entered into the Renishaw application software prior to use.
7. **Traceability.** All the reference standards (listed overleaf) used in these calibrations are traceable either directly to major international metrology institutes who have signed the CIPM Mutual Recognition Agreement (e.g. NPL: UK; LNE: France; NIST: USA; PTB: Germany; NMIJ: Japan) or to a national accreditation body (e.g. UKAS: UK; A2LA: USA).
8. **Environment.** The equipment used for calibration is in a facility held between 15 °C and 25 °C.
9. **Uncertainty calculations.** The uncertainty calculations have been carried out according to the European Co-operation for Accreditation document EA-4/02.
10. **Quality accreditation.** All calibrations above are covered by Renishaw's ISO 9001 quality assurance system. The system is audited and certified by an accredited agency.
11. **Re-calibration.** Customers may wish to confirm that systems are performing within published specifications over time. If so, it is recommended that they should be periodically re-calibrated. Please note that compensators and temperature sensors are re-calibrated only at a single applied temperature, air pressure and humidity. Please refer to the appropriate system manual for further details.